

PUBLICATION COPY

LEVELING
GEODETTIC VERTICAL DATUM OF 1929

35-080-24
MT. PLEASANT QUADRANGLE
NORTH CAROLINA
N3515-W8015/15
DIAGRAM NI 17-2
CHARLOTTE

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY


Cabarrus and Stanly Counties

Final adjustment of 1974

Edition 6/6/77

PR: WSM/sws

NGVD 29
Elevations

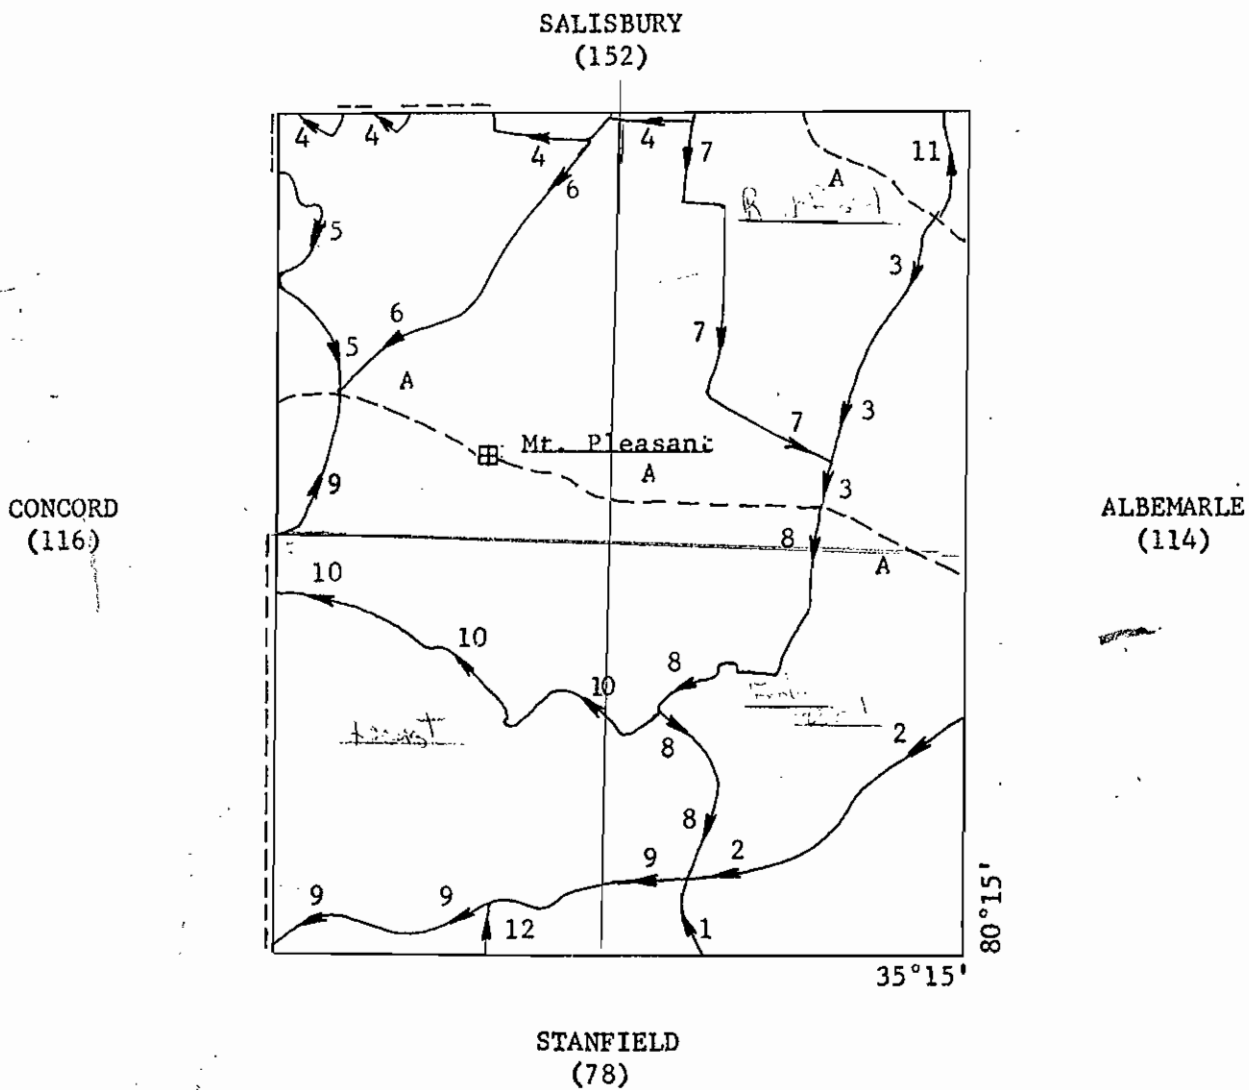

(USC&GS) VERTICAL CONTROL DATA

Quadrangle 350802

INDEX OF PERMANENT MARKS

<u>MARK (USGS)</u>	<u>PAGE NO.</u>	<u>MARK (USGS)</u>	<u>PAGE NO.</u>
PTS 1016	6	WDL 71 1955 665	8
PTS 798 1905 RESET 1966	10	WDL 1 1956 451	9
TT 89 FI 1947 730	6	WDL 2 1956 572	9
TT 94 FI 1947 729	11	WDL 3 1956 602	9
TT 95 FI 1947 673	11	WDL 4 1956 654	10
TT 97 FI 1947 732	6	WDL 5 1956 549	10
TT 90 FI 1949 550	10	WDL 7 1956 585	11
WDL 51 1955 598	3	WDL 8 1956 685	12
*WDL 52 1955 531	3	WDL 9 1956 646	12
WDL 54 1955 506	4	WDL 10 1956 528	12
WDL 55 1955 663	4	WDL 11 1956 674	12
WDL 56 1955 684	4		
WDL 57 1955 702	4	<u>NGS</u>	
WDL 58 1955 769	5,7	LOCUST 1933	10,13
WDL 59 1955 384	3	LOCUST NO 2 1933	10
WDL 60 1955 815	5	LOCUST NO 6 1933	13
WDL 63 1955 700	5	X 49 1933	4,12
WDL 64 1955 746	5	D 96 1935	8
WDL 66 1955 722	6	BEAR 1948	3
WDL 67 1955 653	8	LAMBERT 1948	11
WDL 67 A 1955 799	7	LAMBERT NO 1 1948	11
WDL 68 1955 628	8	MILLING 1948	8
WDL 68 A 1955 611	7	MISEN 1948	7
WDL 69 1955 688	8	MISEN NO 1 1948	8
WDL 69 A 1955 730	7	RED CROSS 1948 (tri)	3,4,9,9
WDL 70 1955 601	9	RED CROSS 1948 (azi)	9
WDL 70 A 1955 706	7		

*WDL 52 Reset 1989

NGVD 29
 Elevations

LINE 1.

Feet

By W.D. Leech, 1955; Book AV 458

2	69	16.91	Oakboro, 1.4 mi NW. Of; 1.2 mi SE. of Red Cross; 25 ft N. of fence line NE.; 25 ft NE of rd.; in concrete post; standard tablet stamped "WDL 51 1955 598" Not Found, 1978	598.034
2	70	19.19	Red Cross; 513 ft N. Of junction of State Highways 27 And 205; 55 ft. E. of center of highway; in concrete post; NGS standard triangulation station "RED CROSS 1948"	646.553

NGVD 29
Elevations

LINE 2

By W.D. Leech, 1955; Book AV 457

4	6	3.87	Albemarle 3.9 mi SW. Of; 0.2 mi W. Of church ft W. of rd. Fork SW.; 25 ft N. of rd.; in concrete post standard tablet stamped "WDL 52 1955 531" See Reset	531.041 Good 11/90
4	6	3.94	Reference mark; 230 ft W. Of tablet; N. Of rd.; on HEADWALL Chiseled square	525.33
4	7	4.67	U.E., S, of rd.; on E. End of pipe under drive SE.; chiseled square	506.58
4	7	5.03	U.E., S. Of rd.; on center of HEADWALL; chiseled square	440.94
4	8	5.37	U.E., in center of S. Side of bridge; copper nail and washer	433.98
4	8	6.06	Albemarle, 6.1 mi SW, of; 330 ft W. Of R.C. Teefer Store & Service Station; 25 ft N.of rd.; in concrete post; NGS standard Azimuth mark disk stamped "BEAR 1948" NOT FOUND, 1978	501.328
4	9	6.07	Reference mark; 50 ft W. of tablet; in root of 12 - in. Oak tree Copper nail and washer	501.50
4	9	6.98	U.E., on step at house, opposite rd. Fork; chiseled square	503.88
4	10	7.91	Red Cross, 2.9 mi NE. Of; 7.9 mi SW. Of Albemarle; 400 ft W. End of bridge over Bear Creek; under telephone line S. Of rd.; in concrete post; standard tablet stamped "WDL 59 1955 384" NOT FOUND, 1978, 1989	384.029

WDL 52 RESET 1989

At the Pine Grove United Meth. Church, in a drill hole in the concrete driveway, at the northwest corner of the church. 32.25 m SE of the centerline of the highway, 4.1 m WNW of the NW corner of the church, 14.95 m WSW of the NE corner of the church, and 18.30 m SSE of the SW corner of a church Sign.

LINE 2 (Cont'd.)Feet

4	11	7.93	Reference mark; 100 ft SW. of tablet; in root of 6-in. pine tree; copper nail and washer	392.84
4	11	8.72	U.E., 80 ft SW. and 50 ft SE. of crossroads; on concrete base of Esso sign; chiseled square	474.00
4	12	9.19	U.E., at NE. corner of bridge; on wingwall; chiseled square	464.77
4	12	9.85	Red Cross, 1.0 mi NE. of; 30 ft E. and 30 ft S. of T-rd. S.; in concrete post; standard tablet stamped "WDL 54 1955 506" (Reported disturbed, 1971) DESTROYED, 1978	505.831
4	13	9.89	Reference mark; 190 ft W. of tablet; S. of rd.; on center of headwall; chiseled square	504.75
4	14	11.05	"RED CROSS 1948" (Described in line 1)	646.553

LINE 3.NGVD 29
Elevations

By W. D. Leech, 1955; Book AV 457

4	16	0.00	"X 49 1933" (NGS) DESTROYED, 1978	656.367
4	16	0.84	U.E., W. of rd.; on concrete pipe; chiseled square	667.26
4	17	1.52	Richfield, 1.5 mi SW. of; opposite house E. of rd.; 30 ft W. of rd.; 5 ft E. of telephone pole; in concrete post; standard tablet stamped "WDL 55 1955 663"	663.261
4	17	1.54	Reference mark; 80 ft SW. of tablet; in root of 14-in. oak tree; copper nail and washer	663.59
4	20	3.31	Richfield, 3.3 mi SW. of; at New Mt. Tabor Methodist Church; in concrete walk at E. entrance; standard tablet stamped "WDL 56 1955 684"	684.095
4	20	3.33	Reference mark; 110 ft S. of tablet; in N. root of oak tree; copper nail and washer	683.77
4	22	4.88	Millingport, 2.0 mi N. of; 4.8 mi SW. of Richfield; 25 ft NW. and 20 ft NE. of T-rd. NW.; in concrete post; standard tablet stamped "WDL 57 1955 702" NOT FOUND, 1978	701.839
4	23	5.06	Reference mark; 950 ft S. of tablet; 160 ft SW. of rd. fork SW. and on S. side of rd.; in root of hickory tree; copper nail and washer	700.16

LINE 3 (Cont'd.)Feet

4	24	6.87	U.E., Millingport; 60 ft W. and 70 ft S. of crossroads; on E. end of concrete base of Esso gas pumps; chiseled square	657.51
---	----	------	---	--------

LINE 4.

By W. D. Leech, 1955; Book AV 457

4	26	1.96	Gold Hill, 2.0 mi S. of; 25 ft W. and 25 ft S. of T-rd. W.; in concrete post; standard tablet stamped "WDL 58 1955 769" <u>NOT FOUND, 1978</u>	769.028
---	----	------	--	---------

4	27	1.97	Reference mark; 20 ft W. of tablet; in root of 8-in. oak tree; copper nail and washer	768.91
---	----	------	---	--------

/Jogs into Salisbury quadrangle/

4	32	5.96	Gold Hill, 2.0 mi S. of, thence 4.0 mi W.; 200 ft S. of crossroads; 20 ft E. of rd.; in concrete post; standard tablet stamped "WDL 60 1955 815"	815.129
---	----	------	--	---------

4	32	5.97	Reference mark; 15 ft N. of tablet; in root of triple pine tree; copper nail and washer	813.94
---	----	------	---	--------

4	33	6.70	U.E., at SW. angle of crossroads; on concrete pipe; chiseled square	794.00
---	----	------	---	--------

/Jogs into Salisbury quadrangle/

4	41	13.64	Rimer, 0.6 mi N. of, thence 0.8 mi W.; 30 ft N. and in line with rd. fork S.; in concrete post; standard tablet stamped "WDL 64 1955 746" <u>(Reported destroyed, 1969)</u>	746.313
---	----	-------	--	---------

4	42	13.65	Reference mark; 30 ft E. of tablet; in root of 12-in. cucumber tree; copper nail and washer	746.14
---	----	-------	---	--------

/Jogs into Concord quadrangle/

4	38	11.42	Rimer, 1.0 mi N. of, thence 1.0 mi E.; 210 ft W. of stream crossing; 20 ft N. of rd.; in concrete post; standard tablet stamped "WDL 63 1955 700" <u>Reported destroyed, 1977</u>	699.826
---	----	-------	--	---------

4	39	11.43	Reference mark; 100 ft W. of tablet; on N. end of pipe under rd.; chiseled square	708.03
---	----	-------	---	--------

4	39	12.03	U.E., 80 ft E. of private rd. N.; on S. end of pipe; chiseled square	749.34
---	----	-------	--	--------

NGVD 29
ElevationsLINE 4 (Cont'd.)Feet

4	50	19.22	Rimer, 1.0 mi W. of; about 175 ft SE. of residence of J. H. Barrier; 22 ft N. of T-rd. S.; in concrete post; standard tablet stamped "TT 89 FI 1947 730"	729.940
---	----	-------	--	---------

LINE 5.

By W. D. Leech, 1955; Book AV 458

4	52	1.19	Rimer; 0.2 mi S. of church; about 0.1 mi NE. of T-rd. SE. at Rimer's Grocery Store; 35 ft S. of house NW. of rd.; on iron post; standard cap stamped "PRIM TRAV STA 1016"	772.813
4	52	1.18	Reference mark; 80 ft NE. of tablet; in maple tree at end of row; copper nail and washer	771.00
4	53	1.64	U.E., SW. angle of T-rd. W.; on pipe; chiseled square	759.58
4	54	2.44	Rimer, 1.2 mi S. of; 121 ft N. and 10 ft E. of Y-rd. N.; in concrete post; standard tablet stamped "TT 97 FI 1947 732" <u>Not found, 1977</u>	731.542
4	54	2.78	U.E., at NW. angle of T-rd. N.; on pipe; chiseled square	690.95
4	54	3.25	U.E., W. end of S. side of bridge; on backwall; chiseled square	664.73
4	55	3.77	U.E., 60 ft SW. of T-rd. SE., NW. of rd.; on E. end of bottom step at entrance to house of J. T. Walker; chiseled square	759.10
4	56	4.37	U.E., NE. of rd.; on pipe; chiseled square	723.97
4	57	5.32	St. Johns Lutheran Church, 1.2 mi N. of; 240 ft S. of T-rd. E.; 20 ft W. of rd.; in concrete post; standard tablet stamped "WDL 66 1955 722" <u>Not found, 1978</u>	721.839
4	57	5.28	Reference mark; 210 ft N. of tablet; E. of rd.; on S. end of pipe under T-rd. E.; chiseled square	723.44
4	58	6.57	St. Johns Lutheran Church, N. side of circular step; on bottom step between hand rail and building; chiseled square	710.09

1955

LINE 6.

NGVD 29
Elevations

Feet

By W. D. Leech, 1955; Book AV 457

4	62	1.73	Gold Hill, 2.0 mi S. of, thence 2.0 mi W., thence 2.6 mi SW.; 5.6 mi NE. of St. Johns Lutheran Church; 35 ft E. of T-rd. W.; in concrete post; standard tablet stamped "WDL 67 A 1955 799"	799.309
4	62	1.75	Reference mark; 120 ft SW. of tablet; in root of oak tree; copper nail and washer	799.86
4	65	3.57	U.E., on NW. corner gas pump at L.H. Harkey Store; chiseled square	720.54
4	66	4.00	St. Johns Lutheran Church, 3.3 mi NE. of; 60 ft SW. of bridge over creek; 25 ft NW. of rd.; in concrete post; standard tablet stamped "WDL 68 A 1955 611"	611.138
4	66	4.11	Reference mark; 610 ft SW. of tablet; 40 ft NW. of rd.; in NE. root of 20-in. maple tree; copper nail and washer	630.72
4	67	4.78	U.E., 11 ft N. of NE. corner of bridge over creek; on stone masonry wingwall; chiseled square	584.86
4	69	6.24	St. Johns Lutheran Church, 1.1 mi NE. of; 55 ft E. of rd. fork SE.; in concrete post; standard tablet stamped "WDL 69 A 1955 730" <u>Reported destroyed, 1977</u> <u>NOT FOUND 1978</u>	729.912
4	69	6.19	Reference mark; 250 ft NE. of tablet; 40 ft NW. of rd.; in root of 20-in. oak tree; copper nail and washer	732.43
4	71	7.35	U.E., chiseled square (Described in line 5)	710.09

LINE 7.

By W. D. Leech, 1955; Book AV 457

5	1	0.00	"WDL 58 1955 769" (Described in line 4)	769.028
5	2	1.95	Gold Hill, 4.0 mi S. of; 30 ft W. and 20 ft S. of T-rd. N.; in concrete post; standard tablet stamped "WDL 70 A 1955 706"	705.866
5	3	1.96	Reference mark; 30 ft SE. of tablet; in N. root of 3-ft oak tree; copper nail and washer	707.75
5	4	3.00	Gold Hill, 4.0 mi S. of, thence 1.0 mi E.; 210 ft W. of T-rd. W.; 150 ft N. of rd.; in concrete post; NGS standard triangulation station disk stamped "MISEN 1948"	754.591

NGVD 29
ElevationsLINE 7 (Cont'd.)Feet

5	4	3.02	Reference mark; 100 ft S. of station; 71 ft W. of SW. corner of house; 50 ft N. of rd.; 24 ft SE. of SE. corner of garage; in concrete post; NGS standard reference mark disk stamped "MISEN NO 1 1948"	753.025
5	6	4.40	U.E., SE. corner of bridge; on concrete wingwall; chiseled square	610.85
5	7	5.10	Finger, 4.1 mi N. of; 25 ft E. of junction of T-rd. W.; in concrete post; standard tablet stamped "WDL 71 1955 665" DESTROYED, 1978	665.112
5	7	5.11	Reference mark; 60 ft SE. of tablet; 20 ft E. of rd.; in root of 10-in. pine tree; copper nail and washer	665.06
5	9	7.07	Finger, 2 mi N. of; 140 ft N. of crossroads; 25 ft E. of rd.; in concrete post; standard tablet stamped "WDL 67 1955 653"	653.262
5	10	7.08	Reference mark; 35 ft S. of tablet; on concrete right-of-way post	651.46
5	12	8.70	Millington, 1.0 mi N. of, thence 1.3 mi E.; 40 ft W. of junction of T-rd. S.; in ledge; standard tablet stamped "WDL 68 1955 628"	627.911
5	12	8.69	Reference mark; 40 ft W. of tablet; on ledge; chiseled square	626.00

LINE 8.

By W. D. Leech, 1956; Book AV 457

5	16	0.00	"D 96 1935" (NGS)	632.210
5	16	1.26	Millington; at high school, at rear end of school; W. side; on steps of entrance; NGS standard azimuth mark disk stamped "MILLING 1948"	680.019
5	18	3.13	Millington, 1.5 mi S. of; 700 ft ^N of T-rd. E.; 30 ft S. of wood line W. of rd.; 25 ft W. of rd.; in concrete post; standard tablet stamped "WDL 69 1955 688"	687.600
5	18	3.14	Reference mark; 20 ft SW. of tablet; in root of 12-in. pine tree; copper nail and washer	688.51

LINE 8 (Cont'd.)Feet

5	19	4.20	U.E., on E. end of pipe under drive to house S. or rd.; chiseled square	645.47
5	20	4.81	Millingport, 3.2 mi S. of; 100 ft S. of crossroads; 30 ft W. of rd.; in concrete post; standard tablet stamped "WDL 70 1955 601" NOT FOUND , 1978	600.707
5	22	6.08	Millingport, 4.4 mi S. of; at W. end of bridge over Big Bear Creek; on N. bridge seat; standard tablet stamped "WDL 1 1956 451" DESTROYED , 1978	450.989
5	23	6.17	Reference mark; 460 ft W. of tablet; 40 ft S. of rd.; in root of 6-in. oak tree; copper nail and washer	453.33
5	23	6.85	Millingport, 5.2 mi S. of; 40 ft W. of drive to house S. of rd.; 30 ft N. of rd.; in concrete post; standard tablet stamped "WDL 2 1956 572" NOT FOUND , 1978	571.887
5	24	6.94	Reference mark; 500 ft W. of tablet; on SE. corner of concrete base of gas pump; chiseled square	572.01
5	25	7.95	U.E., Lambert; on NE. corner of N. end of bottom stone step at entrance to Ridgecrest Presbyterian Church; chiseled square	702.35
5	28	10.22	Red Cross, 2.0 mi N. of; 59 ft NE. of crossroads; 71 ft S. of right-of-way post; 46 ft SW. of right-of-way post; 3.5 ft N. of stop sign; in concrete post at ground level; standard tablet stamped "WDL 3 1956 602"	602.287
5	27	10.21	Reference mark; 71 ft N. of tablet; on top of right-of-way post	601.36
5	29	11.74	Red Cross, 0.5 mi N. of; 70 ft NE. of junction of rd. fork NW.; in concrete post; NGS standard azimuth mark disk stamped "RED CROSS 1948" NOT FOUND , 1978	613.638
5	30	12.11	"RED CROSS 1948" (Described in line 1)	646.553

LINE 9.

By W. D. Leech, 1956; Book AV 457

5	31	0.00	"RED CROSS 1948" (Described in line 1) (Also in line 8)	646.553
---	----	------	---	---------

LINE 9 (Cont'd.)

Feet

5	33	2.15	Red Cross, 2.0 mi SW. of; 2.0 mi NE. of Locust; 37 ft S. of Highway; 28 ft SE. of telephone pole; 118 ft W. of junction of drive leading to Church of God and in line with center of church, at ground level; in concrete post; standard tablet stamped "WDL 4 1956 654"	653.737
5	33	2.19	Reference mark; 220 ft S. of tablet; on E. end of bottom brick step at entrance to church; chiseled square	663.69
5	36	4.44	Locust; 0.15 mi N. of crossroads, at Locust Baptist Church (not used as church now); 2 ft N. of N. side extended; 28.4 ft W. of NW. corner of church; NGS standard triangulation station disk stamped "LOCUST 1933" DESTROYED 1978, 1981	742.504 +178
5	36	4.39	Reference mark No. 2; 240.48 ft SE. of station; 55 ft W. of centerline of rd.; in concrete post; NGS standard reference mark disk stamped "LOCUST NO 2 1933" (Destroyed, 1967)	738.79
5	38	6.73	Locust, 2.1 mi SW. of; 2.3 mi NE. of North Midland; S. of rd.; on W. end of culvert; standard tablet stamped "WDL 5 1956 549" (Reported not found, 1971) DESTROYED 1978	549.092
5	39	6.76	Reference mark; 150 ft NW. of tablet; in root of 8-in. cedar tree; copper nail and washer	551.18
5	40	7.41	U.E., SE. corner of bridge over Rocky River; chiseled square	506.37
5	40	8.50	U.E., S. of rd.; on W. end of culvert; chiseled square	531.32
5	42	9.18	North Midland, 690 ft S. of junction of State Highway 27 and U.S. Highway 601; 195 ft S. of brick pump house; 77 ft W. of centerline of new U.S. Highway 601; in concrete post; standard tablet stamped "PRIM TRAV STA 798 1905 RESET 1966" 91 Good	91 Good 524.160
5	43	10.44	U.E., SW. corner of bridge over Anderson Creek; on wingwall; chiseled square	500.94
5	43	10.92	North Midland, 1.6 mi N. of, along U.S. Highway 601; 28 ft E. of centerline of highway; 30 ft N. and 7 ft E. of fence corner; in concrete post; standard tablet stamped "TT 90 FI 1949 550" NOT FOUND 1978	549.893

LINE 9 (Cont'd.)Feet

5	44	10.94	Reference mark; 100 ft SW. of tablet; in E. root of double oak tree; copper nail and washer	567.55
<u>/Jogs into Concord quadrangle/</u>				
5	53	19.53	Cold Springs Church, in N. corner of church grounds; 62 ft S. and 4 ft W. of T-rd. SW.; about 200 ft W. of service station; 20 ft SW. of cedar tree; in concrete post; standard tablet stamped <u>"TT 94 FI 1947 729"</u>	728.820
5	53	19.48	Reference mark; 170 ft S. of tablet; in W. root of 12-in. oak tree; copper nail and washer	726.97
5	56	21.56	Cold Springs Church, 2.2 mi N. of; 0.5 mi S. of State Highway 73; 51 ft S. and 10 ft W. of Y-rd. SW.; in concrete post; standard tablet stamped <u>"TT 95 FI 1947 673"</u>	672.567
5	56	21.59	Reference mark; 120 ft N. of tablet; 50 ft W. of rd.; in W. root of 10-in. oak tree; copper nail and washer	672.14
5	56	22.02	U.E., 20 ft W. and 20 ft N. of junction of T-rd. S.; on W. end of highway; chiseled square	695.11
5	57	22.26	U.E., St. Johns Lutheran Church (Described in line 5) (Also in line 6)	710.09

LINE 10.

By W. D. Leech, 1956; Book AV 457

5	58	0.00	U.E., chiseled square (Described in line 7)	702.35
5	58	0.30	Lambert; 0.25 mi SW. of school; 250 ft W. of rd.; 65 ft SW. of SW. corner of frame house; in concrete post; NGS standard triangulation station disk stamped "LAMBERT 1948"	747.404
5	59	0.32	Reference mark No. 1; 125.28 ft NE. of station; 26 ft E. of NE. corner of frame house; in concrete post flush with ground; NGS standard triangulation REFERENCE station disk stamped "LAMBERT NO 1 1948"	749.93
5	60	1.45	U.E., 20 ft NE. of junction of T-rd. SW.; on boulder; chiseled square	640.06
5	61	1.96	Lambert, 1.9 mi W. of; at NE. corner of bridge; in concrete wingwall; standard tablet stamped <u>"WDL 7 1956 585"</u>	585.084

NGVD 29
ElevationsLINE 10 (Cont'd.)Feet

5	61	1.98	Reference mark; 80 ft S. of tablet; in root of 10-in. oak tree; copper nail and washer	581.47
5	63	3.83	Lambert, 3.8 mi W. of; 60 ft SW. and 25 ft NW of T-rd. NW.; in ledge; standard tablet stamped "WDL 8 1956 685" NOT FOUND , 1978	685.150
5	64	4.50	U.E., 90 ft N. and 20 ft W. of crossroads; on ledge; chiseled square	657.94
5	64	5.19	Lambert, 5.1 mi W. of; 420 ft NE. of T-rd. NE.; 25 ft SE. of rd.; in concrete post; standard tablet stamped "WDL 9 1956 646" NOT FOUND , 1978	645.495
5	65	5.20	Reference mark; 45 ft S. of tablet; in root of 18-in. oak tree; copper nail and washer	644.83
5	67	7.20	Lambert, 7.2 mi W. of; 120 ft W. and 50 ft N. of T-rd. W.; in concrete post; standard tablet stamped "WDL 10 1956 528" DESTROYED , 1978	527.910
5	67	7.22	Reference mark; 130 ft W. of tablet; in root of triple tree; copper nail and washer	520.35
5	69	8.65	U.E., Miami Church, SE. corner; on concrete base of well; chiseled square	629.75
5	70	9.50	Cold Springs Church, 2.5 mi S. of, thence 1.9 mi E.; 9.5 mi W. of Lambert; 50 ft S. and 40 ft E. of crossroad; in concrete post; standard tablet stamped "WDL 11 1956 674"	673.639
5	70	9.66	Reference mark; 800 ft W. of tablet; 40 ft N. of rd.; in root of 14-in. cedar tree; copper nail and washer	656.58

LINE 11.

By W. D. Leech, 1956; Book AV 457

10	1	0.00	"X 49 1933" (NGS) (Also in line 3) DESTROYED , 1978	656.367
----	---	------	---	---------

1969

LINE 12.Feet

By H. L. Zohn, Jr., 1969; Book AV 1558

2	80	20.06	"LOCUST 1933" (Described in line 9)	<u>Destroyed</u> <u>1974</u>	742.178
2	79	20.05	Reference mark No. 6; Locust; 110 ft SE. of station; in concrete post projecting 0.6 ft; NGS standard reference mark disk stamped "LOCUST NO 6 1933"		743.258

NGVD 29
Elevations